



Yost Auto Tailoring
 3330 W. Castor St.
 Santa Ana, CA 92704
 (714) 719-1392
 CONTACT@YOSTAUTOTAILORING.COM
 WWW.YOSTAUTOTAILORING.COM
 BAR License # 300490

Invoice #2676

Created: 11/14/2023
 Invoiced: 11/17/2023
 Payment Term: On Receipt
 Payment Due: 11/17/2023

NICK ROSHON
 Mobile: (419) 366-1030
 nick.roshon@gmail.com

2006 LAMBORGHINI Murcielago
 VIN: ZHWBU26S96LA02039
 Mileage: 15,709 mi

Customer Comments

NICK ROSHON - 2006 MUCIELAGO ANNUAL SERVICE AND INSPECTION, REVERSE LIGHTS INOP, WINGS HAVE HITCH, OIL LEAK, USE HEAVY WEIGHT OIL!!

MURCIELAGO FULL ANNUAL SERVICE

Description	Price	QTY	HRS	Subtotal
Labor: LABOR TO PERFORM MURCIELAGO ANNUAL SERVICE. OIL CHANGE AND BRAKE FLUSH, FRONT AND REAR DIFFERENTIALS SERVICE, BRAKE FLUID FLUSH. COMPLETE INSPECTION.			5	\$950.00
Part: MURCIELAGO LP640 AVENTADOR OIL FILTER	\$85.36	1		\$85.36
Part: VALVOLINE VR1 20W50 HIGH ZINC	\$18.50	13		\$240.50
Part: CASTROL SYNTHETIC 75W90 GEAR OIL	\$23.99	8		\$191.92
Part: ATE TYP 200 DOT4 BRAKE FLUID	\$27.77	1		\$27.77
Part: COPPER CRUSH WASHER	\$3.00	7		\$21.00
Shop Supplies: \$5.00			Estimated Tax (7.75%): \$44.30	Total: \$1,565.85

CUSTOMER STATES VEHICLE HAS AN OIL LEAK

OIL LEAK AT VALVE COVERS, AND MINOR LEAK FROM FRONT DIFFERENTIAL

Description	HRS	Subtotal
Labor: TIGHTEN VALVE COVERS, AND CLEAN LEAKS	1	\$190.00
		Total: \$190.00

REAR SCOOPS NOT OPERATING SMOOTHLY

LOWER SCOOPS DOWN AFTER RESET

Description	HRS	Subtotal
Labor: PERFORM MULTIPLE RESETS TO CHECK OPERATION. LEAVE SCOOPS DOWN AFTER RESET	1	\$190.00
		Total: \$190.00

MURCIELAGO BRAKE DUCT COMING APART.

Description	Price	QTY	HRS	Subtotal
Labor: INSTALL NEW BRAKE DUCT HOSES			1.25	\$237.50
Part: BULK BRAKE DUCT HOSE SOLD BY THE FOOT	\$25.00	6.5		\$162.50
Shop Supplies: \$5.00			Estimated Tax (7.75%): \$12.98	Total: \$417.98



Yost Auto Tailoring
 3330 W. Castor St.
 Santa Ana, CA 92704
 (714) 719-1392
 CONTACT@YOSTAUTOTAILORING.COM
 WWW.YOSTAUTOTAILORING.COM
 BAR License # 300490

Invoice #2676

Created: 11/14/2023
Invoiced: 11/17/2023
Payment Term: On Receipt
Payment Due: 11/17/2023

Thank you for your business. The work is complete, and your payment is due upon pickup of the vehicle. Mechanics liens may be placed on vehicles until repairs are paid for in full. Please contact us promptly if you have any questions about work performed on your vehicle.

Deposits are non-refundable. No returns or refunds on special ordered items or electrical parts. There is no warranty for used parts or customer supplied parts.

You agree that we are not responsible for loss or damage to your vehicle, including loss of articles left in the vehicle, including, without limitation, in case of fire, theft, or any other cause(s) beyond our control. We are not responsible for any delays caused by unavailability of parts or delays in delivery of parts by the supplier or transporter. You have the right to know before authorizing any additional repairs what those repairs will be and what they will cost.

Totals only include authorized services

Labor	\$1,567.50
Parts	\$729.05
Subtotal	\$2,296.55
Shop Supplies	\$10.00
Tax	\$57.28
Grand Total	\$2,363.83
Paid to Date	(2,363.83)
REMAINING BALANCE	\$0.00

If required repairs exceed the authorized estimated amount, we will obtain your approval to perform the repairs. We will keep you informed and perform only repairs authorized by you. Yost Auto Tailoring does not retain any removed parts after work has been completed. If you would like to retain any removed parts off your vehicle please advise ahead of time and arrange pickup same day vehicle is to be delivered back to you. Removed parts will be disposed of after pickup.

VEHICLES LEFT IN THE POSSESSION OF YOST AUTO TAILORING MORE THAN 30 CONSECUTIVE DAYS AFTER WORK HAS BEEN COMPLETED, WILL BE CONSIDERED ABANDONED & IS AT THE DISCRETION OF YOST AUTO TAILORING TO FILE FOR AN "ABANDONED TITLE"

Signature _____

Payments		
11/20/2023	Visa	\$2,363.83
Total Payments		\$2,363.83

Declined

DIAGNOSE REVERSE LIGHTS ARE NOT COMING ON			
Description	HRS	Subtotal	
Labor: Untitled labor	1	\$190.00	
Shop Supplies: \$10.00		Estimated Tax (7.75%): \$0.78	Total: \$200.78



Yost Auto Tailoring
 3330 W. Castor St.
 Santa Ana, CA 92704
 (714) 719-1392
 CONTACT@YOSTAUTOTAILORING.COM
 WWW.YOSTAUTOTAILORING.COM
 BAR License # 300490

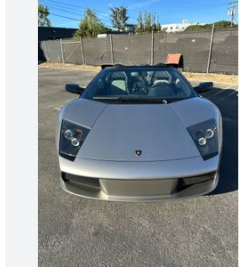
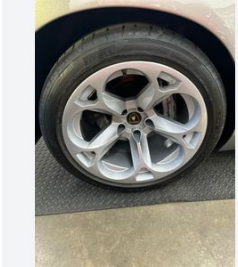


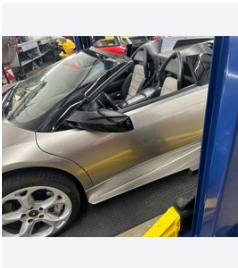
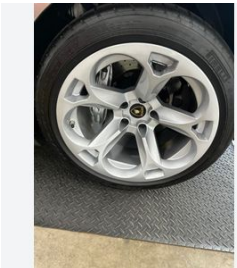
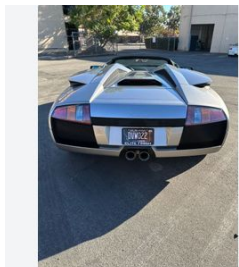


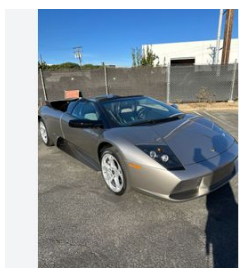

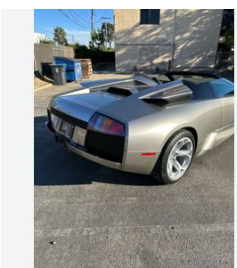
Invoice #2676

Created: 11/14/2023
 Invoiced: 11/17/2023
 Payment Term: On Receipt
 Payment Due: 11/17/2023

NICK ROSHON
 Mobile: (419) 366-1030
 nick.roshon@gmail.com

2006 LAMBORGHINI Murcielago
 VIN: ZHWBU26S96LA02039
 Mileage: 15,709 mi

Check-In Inspection

Item	Green	Yellow	Red	N/A
1 Exterior Walk Around Video / Pictures	✓			
<p>Note/Recommendation:</p> <div style="display: flex; flex-wrap: wrap;">             </div>				

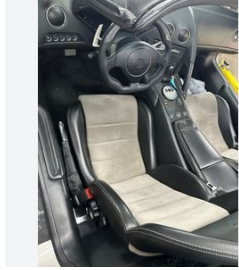

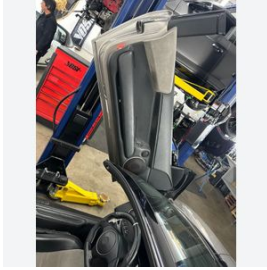
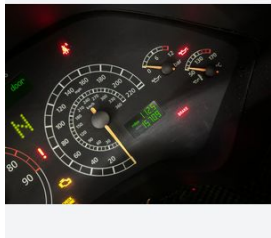
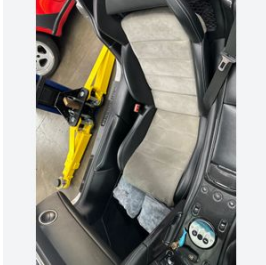
✓



Yost Auto Tailoring
 3330 W. Castor St.
 Santa Ana, CA 92704
 (714) 719-1392
 CONTACT@YOSTAUTOTAILORING.COM
 WWW.YOSTAUTOTAILORING.COM
 BAR License # 300490

Invoice #2676

Created: 11/14/2023
 Invoiced: 11/17/2023
 Payment Term: On Receipt
 Payment Due: 11/17/2023

Item	Green	Yellow	Red	N/A
2 Interior Video / Pictures				
Note/Recommendation:				
    				
Totals	2	0	0	0

Basic Service Inspection

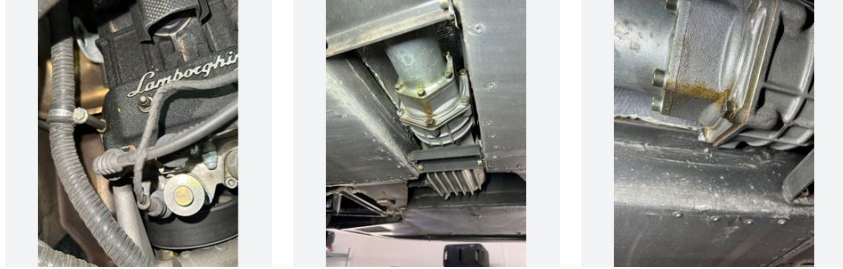
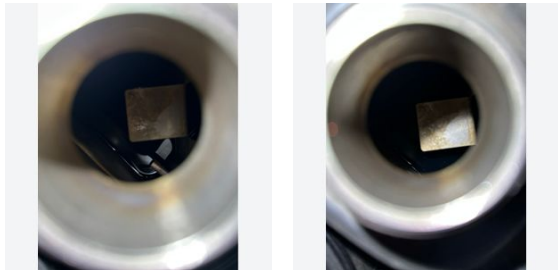
Item	Green	Yellow	Red	N/A
1 Test Drive Performance / Noises				✓
Note/Recommendation: <i>Have not test driven, raining today 11/15</i>				
2 Wipers and Washer Squirter	✓			
Note/Recommendation:				
3 Lights (Head/Break/Turn/Interior)		✓		
Note/Recommendation: <i>Reverse lights are INOP</i>				
4 A/C and Heater Operation- Recharge?	✓			
Note/Recommendation:				
5 Engine Oil Level and or Leaks		✓		
Note/Recommendation: <i>Minor leak around front differential</i>				



Yost Auto Tailoring
 3330 W. Castor St.
 Santa Ana, CA 92704
 (714) 719-1392
 CONTACT@YOSTAUTOTAILORING.COM
 WWW.YOSTAUTOTAILORING.COM
 BAR License # 300490

Invoice #2676

Created: 11/14/2023
 Invoiced: 11/17/2023
 Payment Term: On Receipt
 Payment Due: 11/17/2023

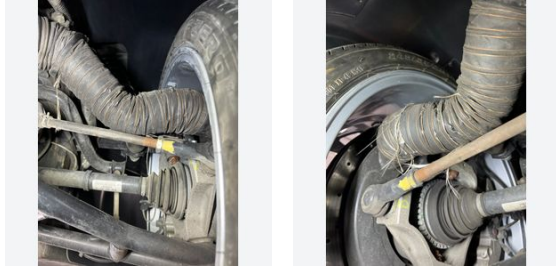
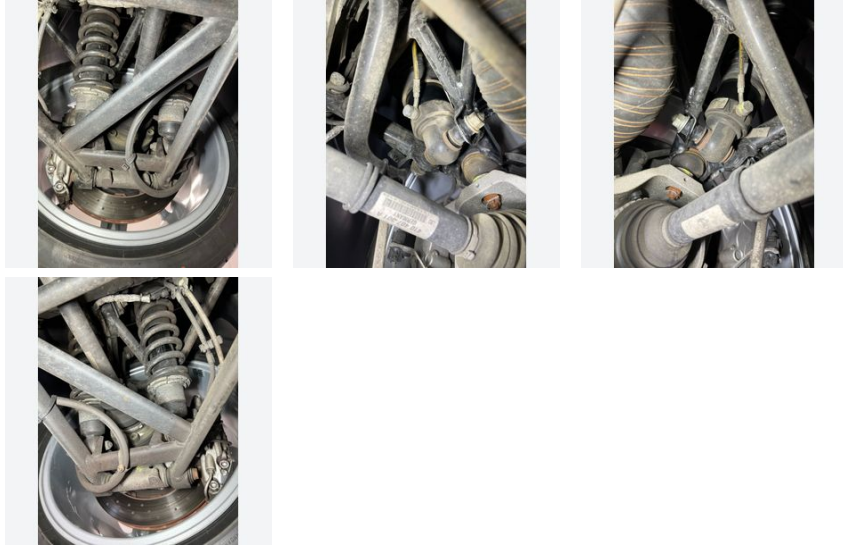
Item	Green	Yellow	Red	N/A
<i>Driver side valve cover has a minor leak</i>				
				
6	Brake Fluid Condition		✓	
Note/Recommendation: <i>Brake fluid looks old</i>				
7	Washer Fluid- Top Off	✓		
Note/Recommendation:				
8	Belts & Hoses- Cracking?	✓		
Note/Recommendation:				
				
9	Antifreeze/Coolant-Top Off	✓		
Note/Recommendation: <i>Will perform with service</i>				
				
10	Air Filter	✓		
Note/Recommendation:				



Yost Auto Tailoring
3330 W. Castor St.
Santa Ana, CA 92704
(714) 719-1392
CONTACT@YOSTAUTOTAILORING.COM
WWW.YOSTAUTOTAILORING.COM
BAR License # 300490

Invoice #2676

Created: 11/14/2023
Invoiced: 11/17/2023
Payment Term: On Receipt
Payment Due: 11/17/2023

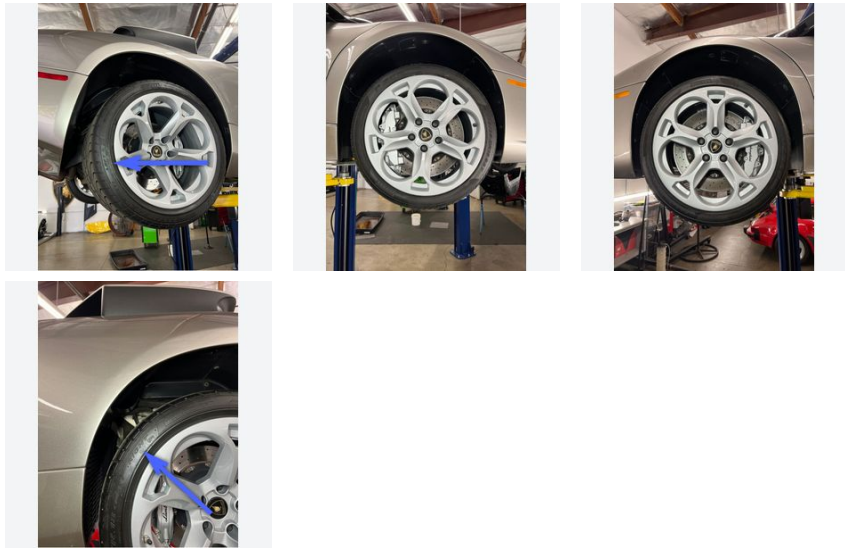
	Item	Green	Yellow	Red	N/A
11	Cabin Filter	✓			
	Note/Recommendation:				
12	Battery Charge / Condition / Cables	✓			
	Note/Recommendation:				
13	Brakes (Pads/Shoes)			✓	
	Note/Recommendation: <i>Front brake ducts are coming apart</i>				
					
14	Shocks & Struts	✓			
	Note/Recommendation:				
					
15	Tires (Wear / Pressure) and Date Codes			✓	
	Note/Recommendation: <i>Rear tires are installed on the incorrect sides Front tires are incorrect spec (MO) and could cause damage to drivetrain</i>				



Yost Auto Tailoring
 3330 W. Castor St.
 Santa Ana, CA 92704
 (714) 719-1392
 CONTACT@YOSTAUTOTAILORING.COM
 WWW.YOSTAUTOTAILORING.COM
 BAR License # 300490

Invoice #2676

Created: 11/14/2023
 Invoiced: 11/17/2023
 Payment Term: On Receipt
 Payment Due: 11/17/2023

Item	Green	Yellow	Red	N/A
				
16 Engine Fault Codes, Time Until Next Service	✓			
Note/Recommendation: <i>Performing service this visit</i>				
17 Torque Wheels	✓			
Note/Recommendation:				
18 Additional Items To Note If Any				✓
Note/Recommendation:				
Totals	11	3	2	2